

Publication date	20/07/2015
Document nr.	SUPAIR_2015/07_001
Number of page	1 / 5



SAFETY NOTE

TOPIC : Unusual wear on leg strap.

RATING : LOW

AVERAGE

CRITICAL

Description of the problem :

Premature wear and tear on the leg strap can appear and compromise harness security.



Products concerned :

WALIBI² => index : A1, A2, A3, B1 and B2

WALIBI LITE => index : A1 to A8

VIP² => index : A1 to A5

VIP LITE => index : A1

Event / Ascertainment :

Premature wear and tear can be detected on the leg straps.

Signs of wear and tear appear in two stages : firstly on the edging, secondly, after some time, on the webbing itself.

Next page ►


Publication date	20/07/2015
Document nr.	SUPAIR_2015/07_001
Number of page	2 / 5

Process :

How to find the production index of my harness ?


Open the back pocket, and look for the certification labels. The index is located on the «little label».

How to know if my harness is concerned ?

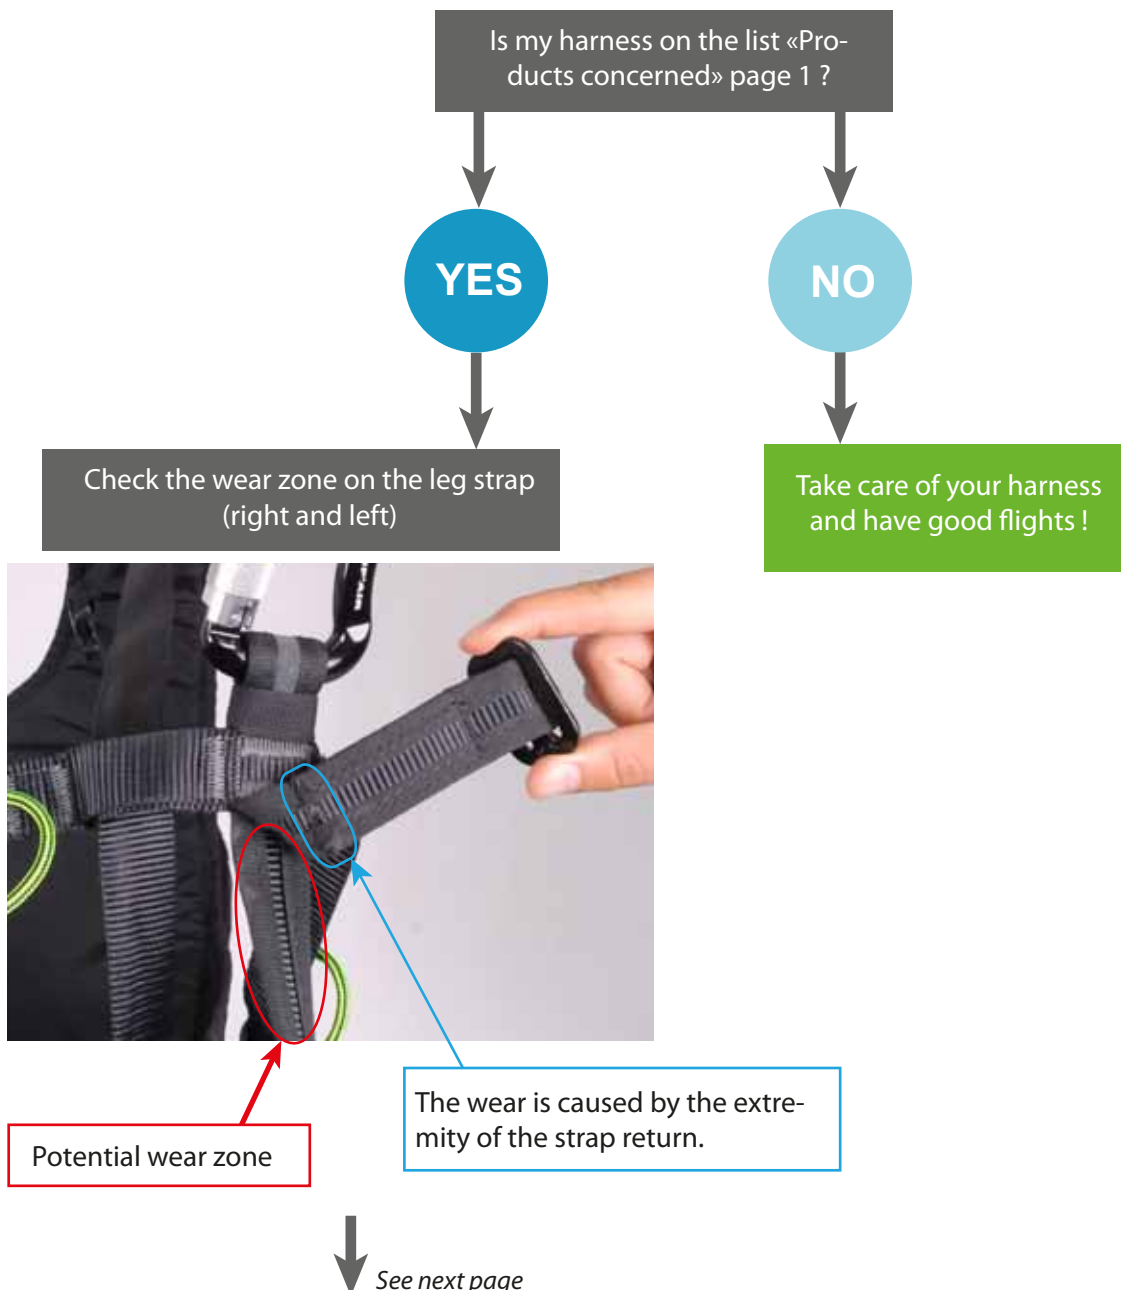

Next page ►

See previous page

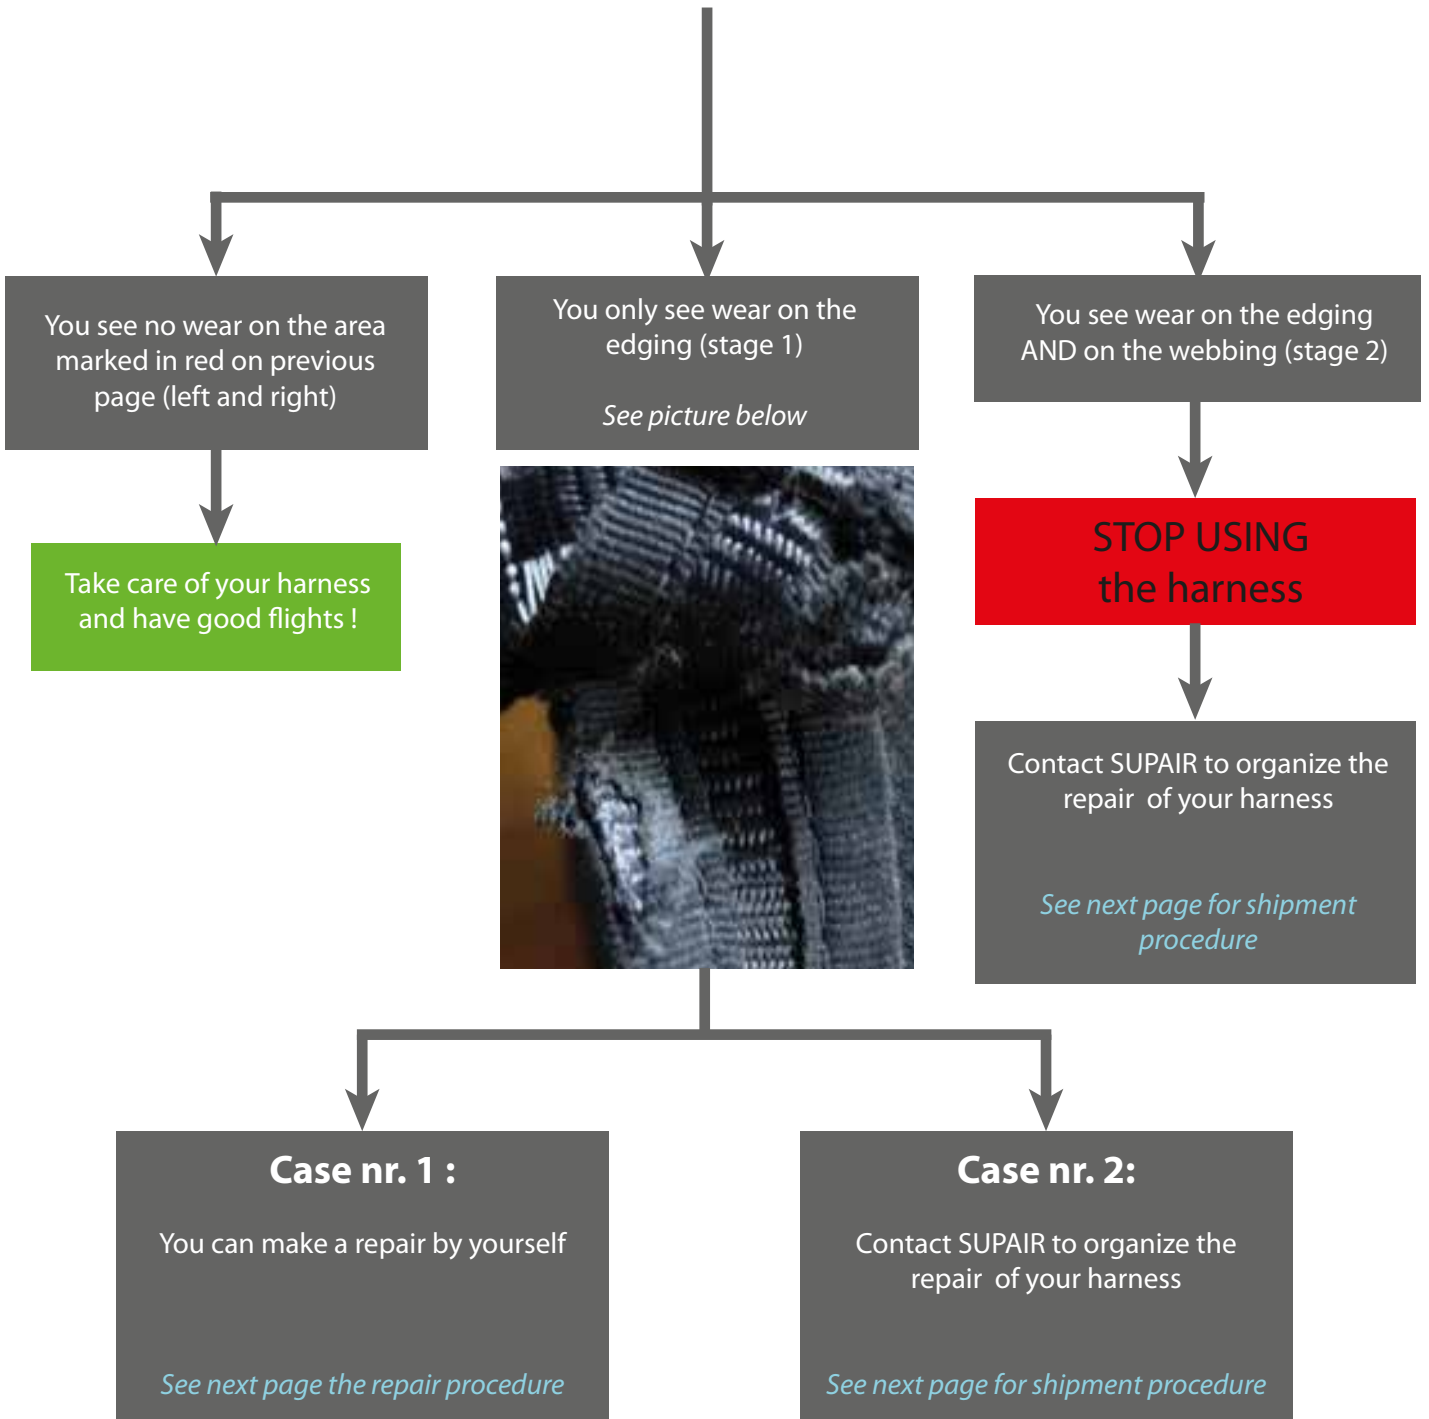

Next page ►

Publication date	20/07/2015
Document nr.	SUPAIR_2015/07_001
Number of page	4 / 5

Shipment procedure:

- 1) Take pictures to show the problem
- 2) Send all the pictures by email with an explanation and your full details (last name, first name, address, phone number, email) at : sav@supair.co
- 3) The harness return procedure will be sent back to you.

Repair procedure :



1

The purpose of repair is to protect the structural strap from the wear caused by the end of the "webbing return" (blue circle).

Structural webbing



2

To make the protection, you have to roll a piece of thin webbing around the end of the leg «strap return». Sew the system to secure the repair.

See the picture on the left.

Next page ►

Publication date	20/07/2015
Document nr.	SUPAIR_2015/07_001
Number of page	5 / 5

Person able to perform the checking :

USER

DEALER

MANUFACTURER

Timing of check :

The checking procedure shall be performed immediately

Receivers :

USER

DEALER

PARAGLIDING SCHOOL

PARAGLIDING ASSOCIATION

PRESS

FEDERATION

Safety note : SUPAIR_2015/07_001