

<b>Published date</b>	30/01/2019
<b>Document number</b>	SUPAIR_2019/01//001
<b>Page number</b>	1 / 2

## Product lifespan / usage advice

### ALTIRANDO 3

### EVOLITE



#### Risk of premature wear :

The fiberglass batten located beneath the seat may, in some instances, pierce the fabric.



#### Concerned models:

##### Harness ALTIRANDO 3

Index B2 to C1


Version C1.1 has been modified and does not pose a problem anymore.



##### Harness EVOLITE

Index A1 à A8.

Version A8.1 has been modified and does not pose a problem anymore.

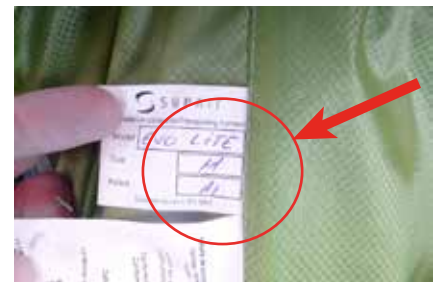

#### Facts / Findings:

The batten was placed inside its sleeve without protection, thus exposing one end with sharp edges.



Suite page 2 ►

<b>Date d'édition</b>	30/01/2019
<b>N° du document</b>	SUPAIR_2019/01//001
<b>Nombre de pages</b>	2 / 2

**Procedure to follow:**

**Remove the batten :**



**Depending on the pilot's size, the batten may or not be useful.**  
 Conduct a hang-test with and without the batten in place.

**Discomfort or lack of thighs support behind the knees**

**No change in comfort or sensations**

Contact us at [sav@supair.com](mailto:sav@supair.com) to receive a batten with two protective end caps corresponding to your harness model and size.

You can fly without the batten inserted inside the harness (a comfort and personal feeling only). Take care of your harness, and have nice flights!

**Person able to perform the harness**

USER       DEALER

