

Published date	13/02/2019
Document number	SUPAIR_2019/02/001
Page number	1 / 2



Safety info

STATUT :

LOW

MEDIUM

CRITICAL

SUBJECT : Front reserve container standard

The coating on the rescue parachute container flaps might become sticky.



Problem description :

The coating of the black Cordura might deteriorate overtime and become sticky. It is possible that the degraded rescue parachute container flaps affect the parachute extraction, making it harder or even impossible.



Concerned products :

FRONT RESERVE CONTAINER STANDARD

Manufactured between 2007 and 2008




Facts / Ascertainment :

During their yearly parachute extraction test, several pilots noticed that the rescue parachute container flaps had become sticky.

(Fabric defect as regards to the stability of the coating overtime)

Suite page 2 ►

Procedure to follow :

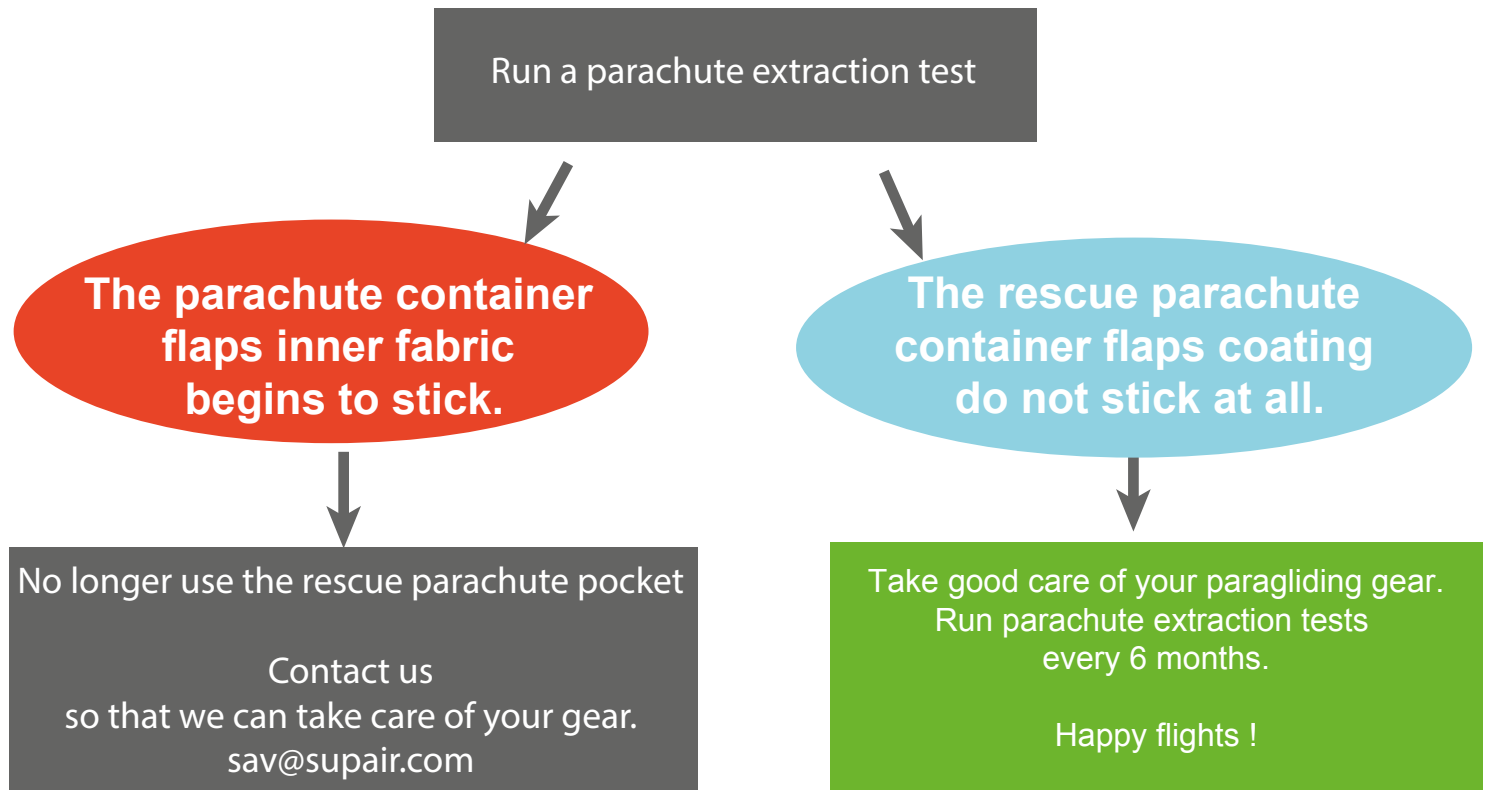

Person able to perform the harness :



DELAIS : **The inspection must be done immediately**

Documents recipients :

